




PERFECT MAKES BOXCO!

# MOULDED PARTS / ABOS

LV breakouts 1-5 fingers

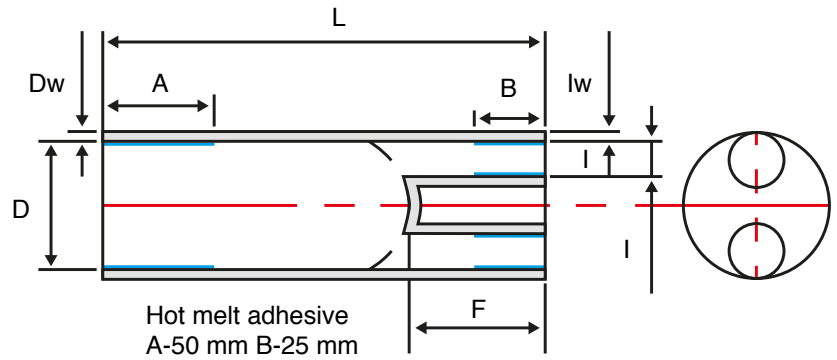

ABOS	D (mm)		I (mm)		Recovered length		Recovered wall thickness (Dw, Lw)	
	a (min.)	b (max.)	a (min.)	b (max.)	L (mm)	F (mm)	Dw (mm)	Lw (mm)
<b>2 cores breakout</b>								
ABOS-LV 2 22/8	22	8	9	3.5	55	18	2.2	1.8
ABOS-LV 2 30/12	30	12	14	4.5	93	23	2.6	2.2
ABOS-LV 2 40/16	40	16	15	5	125	35	2.1	2.1
ABOS-LV 2 60/23	60	23	25	7.5	118	29	2.6	2.6
ABOS-LV 2 60/23-L	60	23	25	7.5	155	45	2.6	2.6
ABOS-LV 2 90-60	90	60	30	8.5	190	50	3.0	3.0
ABOS-LV 2 150/90	150	90	20	6.5	150	70	3.0	3.0
<b>3 cores breakout</b>								
ABOS LV3 38/16	38	16	15	4.5	110	35	2.1	2.1
ABOS-LV3 40/16-L	40	16	15	4.5	125	35	2.1	2.1
ABOS-LV3 60/25	60	25	25	8	165	50	3	2.5
ABOS-LV3 60/24-L	60	24	25	8	180	45	3.2	2.8
ABOS-LV3 80/38	80	38	35	11	185	55	3.5	3.5
ABOS-LV3 80/38-L	80	38	35	11	215	57	4	4
ABOS-LV3 110/50	110	50	46	17.5	250	65	4	4
ABOS-LV3 125/57	125	57	55	20	260	75	4	4
ABOS-LV3 140/70	140	70	62	26	280	75	4	4
ABOS-LV3 170/77	170	77	75	28	280	80	4	4
<b>4 cores breakout</b>								
ABOS LV4 40/15	40	15	14	3.5	105	26	2.2	2
ABOS LV4 55/21	55	21	20	5	150	40	3.1	2.6
ABOS LV4 65/26	65	26	26	7	175	45	3.3	2.9
ABOS LV4 75/26	75	26	28	7	175	45	3.3	2.9
ABOS LV4 82/37	82	37	30	9	190	60	4	3
ABOS LV4 90/37	90	37	32	9	190	60	4	3
ABOS LV4 100/47	100	47	38	12	198	58	4	3
ABOS LV4 125/52	125	52	52	15	240	75	4	4
ABOS LV4 160/70	160	70	64	19	260	75	4	4
<b>5 cores breakout</b>								
ABOS LV5 40/19	40	19	19	4	98	25	2.5	2
ABOS LV5 55/24	55	24	24	5	155	40	3.2	2.6
ABOS LV5 80/33	80	33	33	8	175	53	3	2.8
ABOS LV5 100/42	100	42	42	10	190	60	3	3